









Dimensions and construction:

φ5.2±0.15 (mm)

Tube: Lead-free glass End-cap: Nickel plated brass

Solder: Pb90-Sn*1 Adhesive: Epoxy resin Arc extinguishing material: Confidential

Marking: 100 mA, 200 mA, 250 mA, 315 mA, 400 mA, 500 mA

630 mA, 800 mA, 1.25 A, 2.5 A

SOC [rated current] AC/DC400V SHV12

1 A, 1.6 A, 2 A, 3 A, 3.15 A, 4 A, 5 A, 6.3 A

SOC [rated current] AC/DC400V SHV12

*1 High melting temperature type solders, containing 85 wt% or more lead, that are exempted from the EU RoHS Directive for hazardous substances are used.

Electrical characteristics:

Rated voltage	Certification	Rated current (/ _N)		oreaking rent	Temperature rise	Current carrying capacity/ Endurance test	Pre-arcing time/ current characteristic
AC 500 V		100 mA-6.3 A	80 A	Resistive circuit	75 K or less at 1.0 / _N	Until temperature stabilization occurs at 1.0 / _N	Within 30 min at 2.1 / _N
AC 400 V	74 .		500 A				
	S	1 A, 1.6 A, 2 A 3 A, 3.15 A, 4 A 5 A, 6.3 A			_	*2	*3
DC 400 V			200 A				
	71 ° © :	100 mA-6.3 A	1,500 A		75 K or less at 1.0 / _N	Until temperature stabilization occurs at 1.0 / _N	Within 30 min at 2.1 / _N
			2,000 A				

*2 After repeating 100 cycles of 1.2 /_N for 1 h and switching off for 15 min, 1.5 /_N can be passed through the fuse for 1 h or more.

		• "	•		•	~
*3	Rated current	2.1 / _N	2.75 / _N	4.0 / _N	10 / _N	
	1 A		0.3 s–2 s	0.095 s-0.5 s	0.01 s-0.03 s	
	1.6 A, 2 A	Within 30 min		0.095 s–1 s	0.01 s-0.05 s	
	3 A, 3.15 A 4 A, 5 A, 6.3 A	Within 30 min	1 s–30 s	0.15 s–1 s	0.02 s-0.1 s	

Typical cold resistance:

Rated current	Cold resistance	Rated current	Cold resistance	Rated current	Cold resistance
100 mA	20 Ω	630 mA	580 mΩ	2.5 A	36 mΩ
200 mA	5.8 Ω	800 mA	370 mΩ	3 A	30 mΩ
250 mA	4.0 Ω	1 A	160 mΩ	3.15 A	25 mΩ
315 mA	3.9 Ω	1.25 A	100 mΩ	4 A	20 mΩ
400 mA	2.2 Ω	1.6 A	80 mΩ	5 A	13 mΩ
500 mA	630 mΩ	2 A	55 mΩ	6.3 A	10 mΩ

Note: These values are for reference only and are not intended to infer any guaranteed values.


Agency approval information:


Agency/Standard	Ratings covered
UL248-1, UL248-14 Recognized	
CSA C22.2 No.248.1, CSA C22.2 No.248.14 Component Acceptance	100 mA-6.3 A
SEMKO Certified EN (IEC) 60127-1, EN (IEC) 60127-7	1 A, 1.6 A, 2 A 3 A, 3.15 A, 4 A 5 A, 6.3 A

Pre-arcing I-t characteristic:

These I-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the fuse may vary depending on the usage conditions. Always test the fuse under the actual circuit conditions.


Control No.: 130214

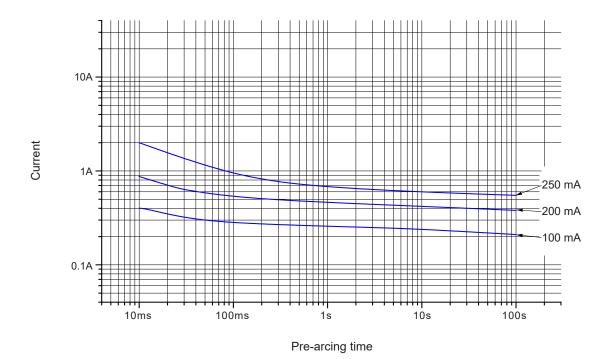

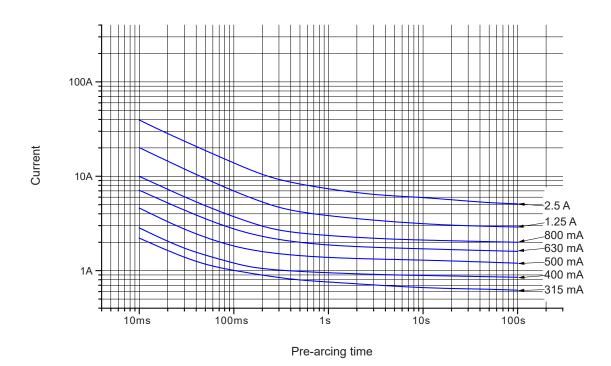

Pre-arcing I-t characteristic:


These I-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the fuse may vary depending on the usage conditions. Always test the fuse under the actual circuit conditions.

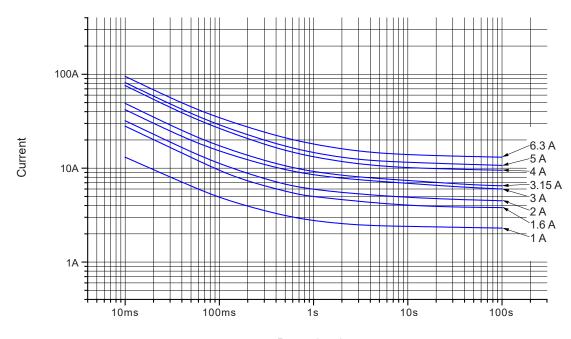


Pre-arcing l²t-t characteristic:

These I²t-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the fuse may vary depending on the usage conditions. Always test the fuse under the actual circuit conditions.


Control No.: 130214

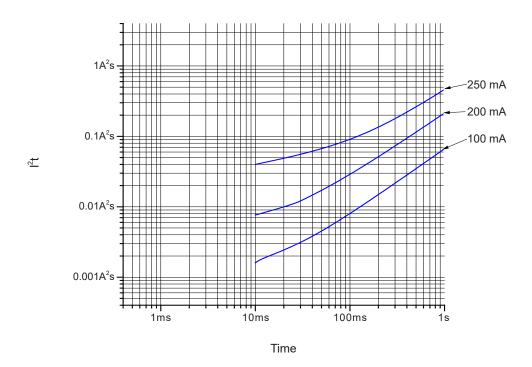

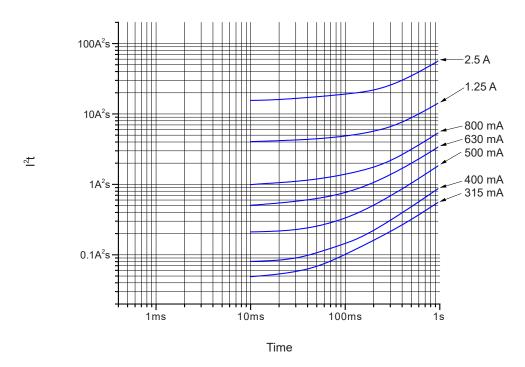

Pre-arcing I²t-t characteristic:


These I²t-t curve plots are of the average values of the measurements obtained under the conditions specified by our company. These data are for reference only and are not intended to infer any guaranteed values. Characteristics of the fuse may vary depending on the usage conditions. Always test the fuse under the actual circuit conditions.

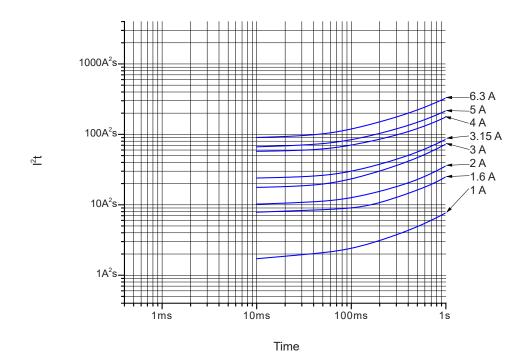


Influence of ambient temperature-the re-rating of the rated current:

This chart is a plot of the measurements obtained at the ambient temperatures of -40 °C, 25 °C, and 85 °C under conditions specified by our company. The conditions of your actual application are not considered in this chart. These data are for reference purposes only and are not intended to infer any guaranteed values. Fuse characteristics may vary depending on the usage conditions. Always test the fuse under the actual circuit conditions.

Control No.: 170401

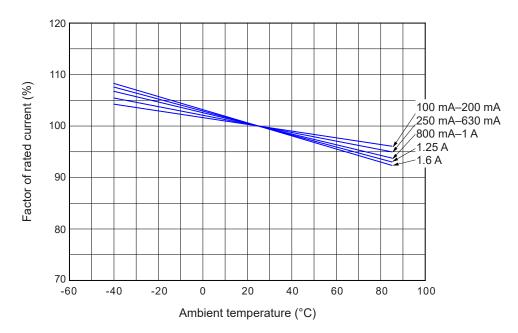

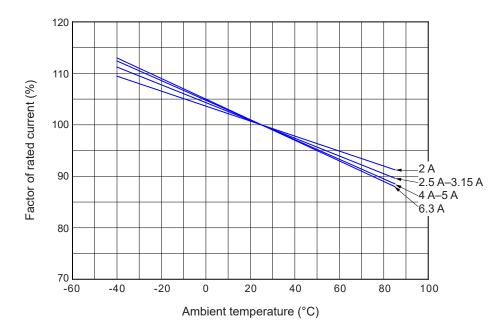

Usage conditions:

* Ambient temperature: -40 °C-+85 °C * Ambient humidity: 85% RH or less

Note: Current carrying capacity of the fuse may vary depending on the ambient temperature.

Storage conditions and storage period:

Products packaged as delivered can be stored for one year from the date indicated on the packing label under the following conditions:

* Ambient temperature: -30 °C-+40 °C (no condensation)

* Ambient humidity: 85% RH or less

* Ambient atmosphere: Not exposed to corrosive gas or sea breeze

No visible dust

Not exposed to direct sunlight


* Load: No application of load that may cause deformation or degradation of the product.

Environmental information:

This product conforms to the EU RoHS Directive 2011/65/EU and 2015/863. The ten hazardous substances (lead, mercury, cadmium, hexavalent chromium, poly brominated biphenyls [PBB], poly brominated diphenyl ethers [PBDE], bis phthalate [DEHP], butyl benzyl phthalate [BBP], dibutyl phthalate [DBP] and diisobutyl phthalate [DIBP]) specified in the EU RoHS Directive are not used intentionally in this product. However, when lead is used in applications exempted from the requirements of the Directive, this will be indicated in the Dimensions and Construction section of the corresponding product specification.

Packaging:

- 1. 1,000 fuses are packed into a colorless transparent polyethylene bag.
- 2. An identification label is attached to each bag.
- 3. A bag of 1,000 fuses is packed into the cardboard case shown in the figure below. If the number of fuses is less than the fixed number, the fuses are still packed into the cardboard case in the same manner.
- 4. The following are indicated on the surface of the cardboard case:
 - * Your part number (by request)
 - * Quantity of fuses
 - * Packaged date
 - * Country of origin
 - * Manufacturer
 - * Production facilities
 - * Indications required by the applicable standards

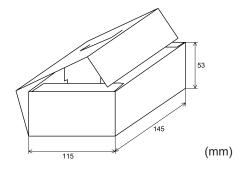

Lot number:

The lot number indicates the following:

Example: 17012371 170123: Date manufactured

71: Process code

Ordering specifications:

SOC product name: SHV12 [rated current]

Contact information:

SOC is a global ISO9001 and IATF16949 registered company headquartered in Japan with subsidiaries in Asia, Europe, and North America.

SOC Corporation

Marketing Division: 3-16-17, Takanawa, Minato-ku, Tokyo 108-0074, Japan

TEL +81-3-5420-1011 FAX +81-3-5420-6699 https://www.socfuse.com/contact/index.html

SOC America Inc.: 414 S Service Rd #519, Patchogue, NY 11772 USA

TEL +1-631-472-6666 http://www.socamericainc.com info@socamericainc.com

SOC Asia Pte. Ltd.: 15 Jalan Kilang Barat, #07-02 Frontech Centre, Singapore 159357

TEL +65-6376-4115

http://www.socfuse.com/contact/index.html

socjp@pacific.net.sg

SOC Europe B.V.: Databankweg 1, 3821 AL Amersfoort, the Netherlands

TEL +31-33-450-4000 http://www.soceurope.nl info@soceurope.nl

Safety Precautions for Fuse Selection and Use:

Read and follow these precautions before selecting and using fuses and protectors (hereafter "fuses"). Failure to properly select, install, and use fuses can result in not only property damage, but also serious injury or death.

Use fuses within their specification requirements. Exposing fuses to conditions that exceed or are outside specifications can lead to, for example, non-operation, nuisance operations, disconnection of the fuse-element, or explosions, and may cause injuries and/or property damage. Please note that breaking conditions for currents below the minimum breaking current and which exceed the rated breaking current are outside the range of the specification conditions. Please use this product after ensuring that the actual breaking conditions in the application are not included in this range.

Fuse performance can vary greatly due to the actual conditions fuses are operated under (ambient temperature, pulse currents, heat shock, mechanical stress, etc.). Please consider all conditions a fuse will be exposed to when making a selection. Depending on the conditions, non-operation, nuisance operations, disconnection of the fuse-element, explosions, or other accidents may occur, and these may cause injuries and/or property damage.

The breaking ability of a fuse will differ between AC and DC circuits. Use fuses with AC voltage ratings in AC circuits and fuses with DC voltage ratings in DC circuits. When using fuses with both AC and DC voltage ratings, attention should be given to any differences in breaking ability. A fuse's breaking ability indicates the fuse's ability in an AC or DC circuit. For example, if a fuse with an AC voltage rating is used in a DC circuit, the fuse's breaking ability will decrease, and injuries and/or property damage may occur.

Check if the circuit voltage is large enough for the fuse's operation. When the circuit voltage is too small, the decrease in current caused by an increase in the fuse's resistance may prevent the fuse from operating even for abnormal currents.

Do not use fuses in environments with high humidity or corrosive or flammable gases. Doing so may result in nuisance operations, disconnection of the fuse-element, or an explosion.

Do not use ultrasonic waves to clean fuses. Ultrasonic cleaning may cause disconnection of the fuse-element.

Do not form a fuse's leads when the fuse is at a temperature of 40 °C or greater. Doing so may result in disconnection of the fuse-element because of the applied stress.

Do not apply coating or potting to any fuses except sealed fuses, such as the MCFA, or their equivalents, including the MCF3. Doing so may cause disconnection of the fuse-element or a change in the fuse's characteristics. Please be aware that even sealed fuses or the equivalent are not hermetically sealed, and therefore make sure to confirm no coating or potting material has penetrated the interior or any other location of the fuse before use. As coating or potting a fuse will changes its characteristics, make sure to confirm that a coated or potted fuse still satisfies all requirements under actual usage conditions.

Avoid applying excessive force when inserting a fuse into a fuse holder. Doing so may result in the fuse cracking or in contact failure, and this may significantly reduce its ability to work properly or may shorten its life.

When a fuse is used in equipment that directly affects human life or that requires a high degree of reliability, more closely examine and evaluate the fuse in actual circuit conditions than is necessary for use in other general electronic equipment.

Do not touch fuses when they are carrying a current. Doing so may result in electrocution or serious burns.

Fuses obtained as samples should only be used for evaluation. Do not reuse fuses, but instead properly dispose of them.

For final fuse selection, make sure to install the fuse in the actual application in order to confirm the selected fuse satisfies all requirements.